

Manhole Inspection Summary

Manhole # S35M__037MH

Printed On: 1/29/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **35M** Node: **037** Status: **Found**

Insp Date: **3/24/08 9:06 AM**

Incomplete Comments

Crew: **5**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **600 light st**

Cross Street: **key highway**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists

Material: **Brick and Concrete**

☐ Parged

Height: **7** (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☒ **Deteriorated**

Infiltration: ☐ None

☒ **Joint**

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound

☒ **Cracked**

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☒ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☐ Sound

☒ **Cracked**

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☒ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft.

Azimuth: **0**

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

Steps

Count: **8**

Missing: **0**

☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth: **0** (ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S35M__037MH


Printed On: 1/29/2009

Page 2 of 4

Location View



Top View

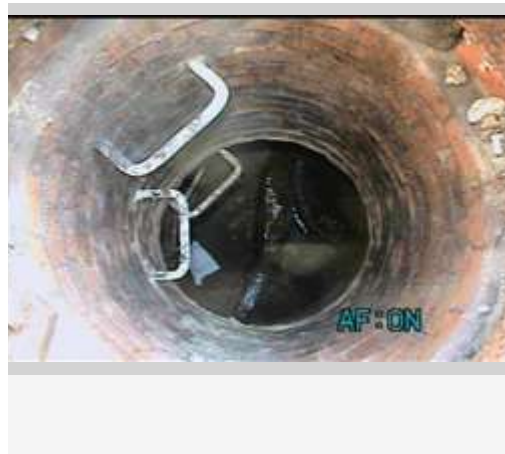


Defect 4



cracked corbel & barrel

Defect 3

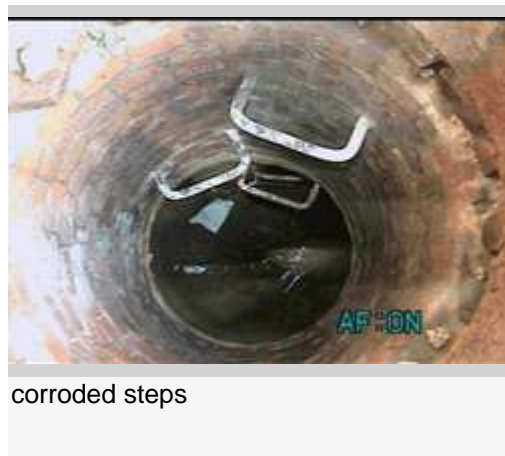

corroded steps

Defect 2



infiltration from cover

Defect 1



chimney cond deteriorated, signs of infiltration, Frame Adjustment

Manhole Inspection Summary

Manhole # S35M__037MH

Printed On: 1/29/2009

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.63** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 4 O'Clock

4 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.58** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S35M__037MH

Printed On: 1/29/2009

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **0** (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection